



# Service Informational Letter

Fuel Systems

Bulletin No.: #CF98001 • Date: September 15, 1998

## **FAULTY RSA-10 FUEL DIAPHRAGM ASSEMBLIES (P/N: 2541803) MANUFACTURED BY PRECISION AIRMOTIVE, EVERETT, WA**

**Reference:** Textron Lycoming Mandatory Service Bulletin #532  
Precision Airmotive Mandatory Service Bulletin #PRS-103

It has come to our attention that fuel diaphragm assemblies (P/N:2541803) manufactured by Precision Airmotive from 9-30-97 through 5-12-98 have been recalled due to insufficient heat treatment of the metal diaphragm washers.

This notice is to assure our customers that Consolidated Fuel Systems' (CFS) diaphragms are not subject to this recall. CFS manufactures its' own FAA-PMA approved diaphragm assemblies (CF2541803) which are exclusively used and sold by Consolidated through our distribution network. Therefore, any CFS Fuel Servos or diaphragms sold by our distributors during the above mentioned time period need only to be marked in accordance with Lyc. S.B. 532 Section III, Paragraph B, line 1.

Proper compliance requires a "D" be marked on the Fuel Servo Data Tag above the serial number and that an appropriate annotation be made in the logbook(s).

**Time of Compliance:** At the next 100 hour inspection or next annual inspection whichever occurs first, but in no case later than May 1, 1999.